

DELL[®] 5100CN

EASY TO REMANUFACTURE CARTRIDGE INSTRUCTIONS




DELL 5100CN TONER CARTRIDGE

REMANUFACTURING THE DELL 5100CN TONER CARTRIDGE

By Mike Josiah and the Technical Staff at UniNet



The Dell 5100CN series toner cartridges are rated for 9,000 pages at 5% coverage. The OEM part numbers are the 310-5807 Black, 310-5810 Cyan, 310-5809 Magenta, and 310-5808 Yellow. There is a chip on the cartridge that must be replaced each cycle. These cartridges have developer mixed with the toner. New replacement toner has the developer pre-mixed.

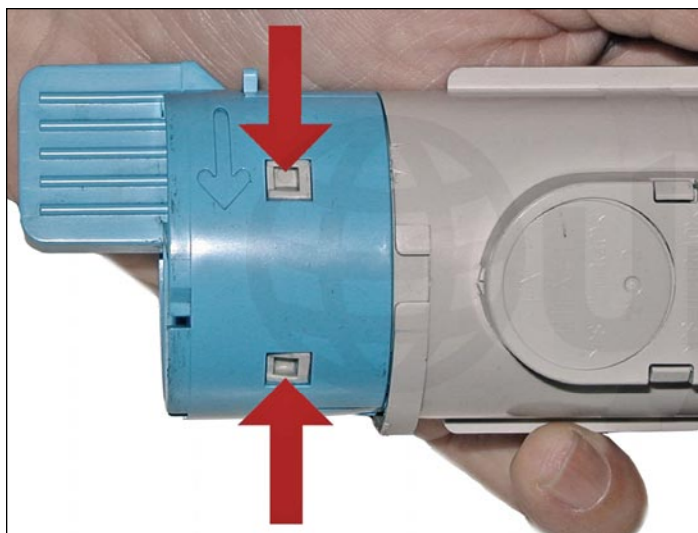

1. Carefully pry off the colored end cap by lifting up on the plastic around the tabs.



2. Remove the end cap.




3. Very carefully pry out the fill plug
It is very soft and easily damaged!





4. Remove all the old toner and fill with new Dell 5100CN toner.




5. Replace the fill plug and end cap.

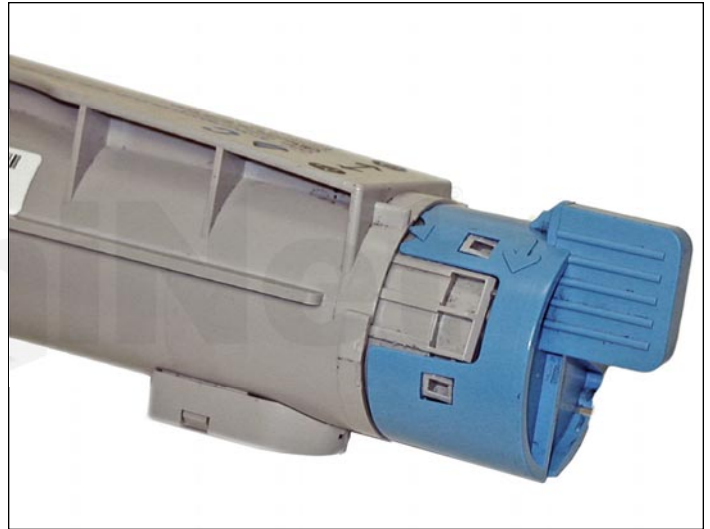

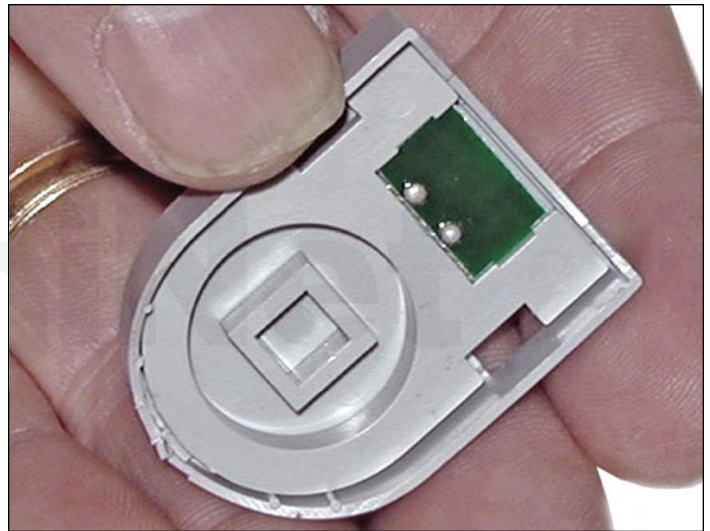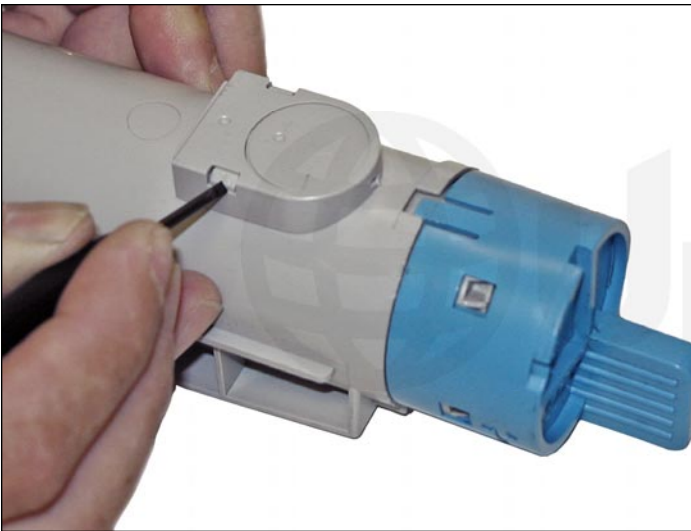


6. Press in on the tabs of the chip holder.

Remove it from the cartridge.

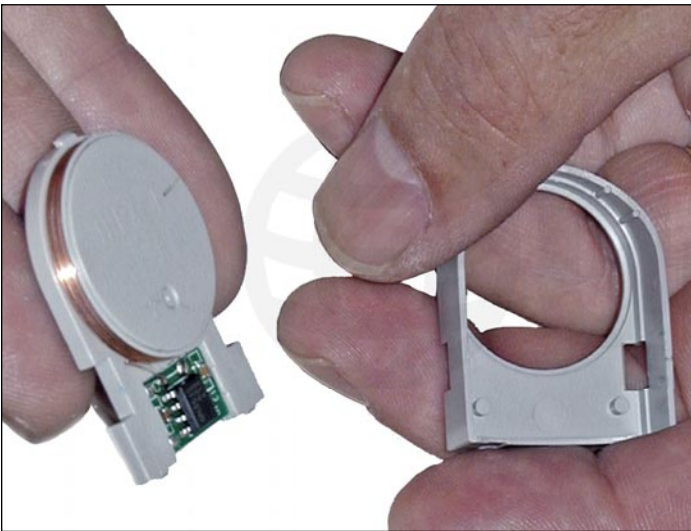

7. Separate the chip from the holder

Replace the chip.

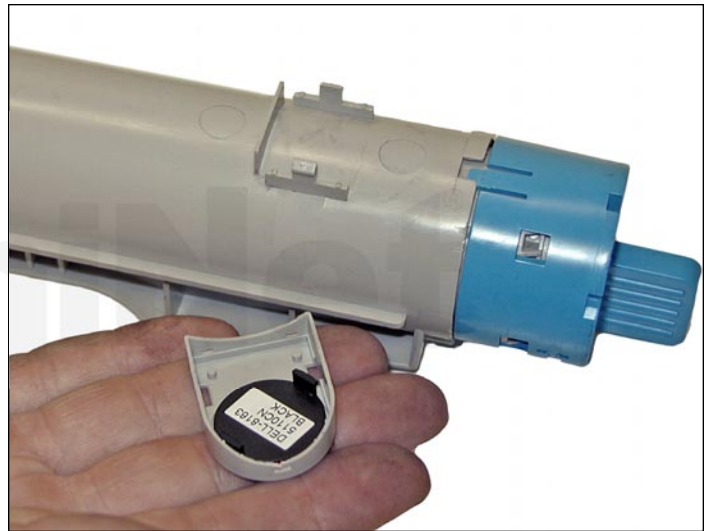

8. Snap the chip holder back on the cartridge.